

WATERPROOF KITCHEN SCALES 15kg x 2g



USER MANUAL

WATERPROOF KITCHEN SCALES

MODEL: EEH3

DISTRIBUTED BY:



p: 0800 503 335 | w: www.southernhospitality.co.nz
e: online@southernhospitality.co.nz

Thank you for choosing and purchasing our products. Please carefully read the operating instructions before use, for correct application and satisfactory results.

TABLE OF CONTENTS

1. Introduction	3
General information.....	3
Contents	3
2. Specifications	4
3. Overview of Controls and Functions	4
4. Normal Weighing Mode	5
5. Setting the Tare Weight	5
6. Adjusting Display Brightness	6
7. Check Weighing (Data Compare) Mode	6
8. Counting Mode	7
9. Calibration Mode	8
10. Calibration	9
11. Display Symbol Meaning	10
12. Troubleshooting	10
13. Battery and Charging	11
14. Character Prompt Definitions	11

1. Introduction

General Information

- Read and understand all operating instructions before using this product. Keep this manual for future reference.
- Don't use sharp objects to operate the keyboard. The waterproof membrane may become damaged.
- Record the weight shortly after loading the platform. After extended periods, the load cell's output signature may result in a less accurate reading.
- Place the scale on a hard, flat surface. Locate the leveling bubble and adjust the base feet as needed to ensure the scale is level before using.
- Avoid extended exposure to extreme heat or cold. Optimum operation is at normal room temperature. Allow the scale to acclimate to room temperature before using.
- Allow sufficient warm up time. Turn the scale on and allow up to 2 minutes for internal components to stabilise before weighing.
- Electronic scales are precision instruments. Do not operate near cellphones, radios, computers or other electronic devices that emit radio frequencies that may cause unstable readings. If the scale performs poorly, try moving to a different room or location.
- When storing the scale for extended periods, the battery must be charged every 90 days to avoid premature performance degradation. Over time, the operating time per charge will degrade. If the operating time is no longer acceptable even after recharging, the battery must be replaced.
- Avoid using in heavy vibration or heavy airflow conditions.

Contents


- Scale
- Owner's manual

2. Specifications

Model	EEH3
Max Capacity	15kg (33 lb)
Readability	2g (0.005 lb)
Divisions	7500
Construction	Stainless steel pan, ABS plastic housing
Waterproof Rating	IP68
Weighing Units	kg / lb / g / lb:oz / pcs
Modes	Weighing, counting, check weighing
Working Temperature	-5°C to 35°C (25°F to 95°F)
Storage Temperature	-25°C to 50°C (-10°F to 50°C)
Power Supply	6V 3.8mAh Ni-MH battery or AC power cord
Max Tare	100% max capacity
Platform Dimensions	230 x 190mm; 9" x 7.5"
Base Dimensions (LxWxH)	287 x 236 x 110mm, 11.3" x 9.3" x 4.3"

3. Overview of Controls and Functions

Function Keys

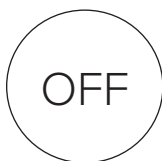

Power off



Power on
and Zero



Sets parameters
and input date



Tare key

4. Normal Weighing Mode

1. Place the scale on a flat, stable surface. Level the scale using the leveling bubble.
2. Power on the scale by pressing the **ON/ZERO** key. There will be an audible tone, the firmware version will be shown and then the display will count down from 9 to 0. When the ZERO light is on, the scale is ready for use. If the ZERO light does not come on, press the **ON/ZERO** key again to zero the scale.
3. To change the weighing unit of measure, see User Setup instructions.
4. Set tare if desired.
5. Place objects on the scale platform and read the weight on the indicator.
6. When finished weighing, press the **OFF** key.

Note: To save battery power, the scale has two power saving features:

- a. Power Saving Mode: The display will darken after 40 seconds with no weight on the platform, but the scale is not off. Adding weight to the platform will automatically turn the display back on.
- b. Auto Off: Scale will automatically turn off after 10 minutes with no key activity or weight change.

Note: If the battery voltage falls below 5.6V, the scale will automatically power off.

5. Setting the Tare Weight

1. Place an empty container on the platform and press the **TARE** key. The display will return to zero, eliminating the weight of the container. The ZERO light will go off and the TARE light will be lit.
2. Put the material or objects to be weighed in the container. The net weight will be displayed.
3. To exit TARE mode, remove all weight from the scale. The display will show a negative weight. Press the **TARE** key to return the display to zero, eliminating the weight of the container. The TARE light will go off and the ZERO light will be lit. If the ZERO light is not lit, press the **ON/ZERO** key to zero the scale.

6. Adjusting the Display Brightness

1. From normal weighing mode, press the **ON//ZERO** key for 3 seconds.
2. The default setting of **LU-1** will be displayed. Press and release the **SET/0~9** key to cycle through **LU-0** to **LU-3** where **LU-3** is the brightest setting. **LU-1** is recommended to maximise battery life.
3. Press the **TARE** key to select and return to normal weighing mode.

7. Check Weighing (Data Compare) Mode

The check weighing or data compare function allows the user to input a pre-set range and the display will indicate whether the weighed value is within that range or indicate if it is too high or too low.

1. From normal weighing mode, press the **SET/0~9** key for 3 seconds to enter Setup mode.
2. Press and release the **SET/0~9** key to cycle through the parameters until **rAngE** is shown. Press the **TARE** key to confirm.
3. Press the **SET/0~9** key until **ON** is shown. Press the **TARE** key to confirm.
4. The previously used lower limit value will be displayed with the first digit flashing and the Under light flashing. Enter the lower limit of the check weighing range using the **SET/0~9** key to increase the flashing digit and the **TARE** key to accept a digit and move to the next position.

Note: The decimal does not appear on the display when entering limit values, but the value should be entered as if it did appear. For example: A lower limit of 2.55 pounds should be entered as 02550 on the display.

5. The previously used upper limit will be displayed with the first digit flashing and the Over light flashing. Enter the upper limit of the check weighing range using the **SET/0~9** key to increase the flashing digit and the **TARE** key to accept a digit and move to the next position. After the last digit has been entered, the scale will return to weighing mode and check weighing may begin.

Note: The upper limit must be larger than the lower limit. If it is not **oFF** will be displayed and the scale will return to the normal weighing mode and check weighing will be deactivated.

6. Place objects on the scale platform. The weight will be shown on the display. If the weight is within the specified range, the Accept light will be lit and an audible tone will sound. If the value is outside the specified range, the Over or Under light will be lit up with no audible sound.

Note: The audible tone parameter can be changed from its default within User Setup mode.

Note: If the weight has not been stabilised, no lights will be lit up.

7. To turn off the check weighing function, enter Setup mode following Steps 1–3 above and change the setting to **oFF**

8. Counting Mode

The counting function calculates and displays the piece quantity of the load that is being weighed.

1. From normal weighing mode, press the **SET/0~9** key for 3 seconds to enter the Setup mode.
2. Press and release the **SET/0~9** key to cycle through the parameters until **Units** is shown. Press the **TARE** key to confirm.
3. Press the **SET/0~9** key until **PcS** is displayed. Press the **TARE** key to confirm. The PCS light will be lit.
4. If a piece-weight has been entered previously, it will be shown. If no piece-weight exists in the scale's memory, the PCS light will flash. To use the existing piece-weight skip to Step 7 below to begin counting items. To enter a new piece-weight, follow Steps 5 and 6.
5. While in counting mode, press and hold the **ON/ZERO** key until the word **COUnT** is displayed briefly. Then the PCS light will flash and **0** will be displayed.
6. Place a known quantity of items on the scale platform and press the **TARE** key. **00000** will be displayed with the first zero digit flashing. Enter the quantity of items using the **SET/0~9** key to increase the flashing digit and the **TARE** key to accept a digit and move to the next position. After the last digit is entered, the scale calculates the piece-weight and displays the count on the scale.
Note: Piece quantity must be between 1 and 30,000.
7. Begin weighing. The piece-count will be displayed, but the weight will not.
8. To change the piece count, repeat Steps 5 and 6.
9. To turn off the counting function, follow Steps 1–3 above and change the setting from PCS to a unit weight.

9. Calibration Mode

Note:

- A standard calibration weight of 100% of the scale's rated capacity is required.
 - The calibration operation must be in kg or g.
 - There is a seal on the underside of the scale. Removing the seal is necessary to perform a calibration, but doing so void the manufacturer's original calibration.
1. Power off the scale.
 2. Turn the scale upside down, remove the seal and use a small screwdriver to remove the two screws holding the calibration switch cover. Move the calibration switch to the ON position (toward the front of the scale)
 3. Place the scale on stable, level surface and press the **ON//ZERO** key to turn the scale on.
 4. After the self-check is complete, press and hold the **TARE** key until **CAL** is briefly displayed, followed by **0**.
 5. With the platform empty, press the **TARE** key to set the zero point. **H9** for kg or **9** for g will be displayed.
 6. Toggle to kg or g depending on your choice of calibration weight using the **SET/0~9** key. When the desired unit of measure is displayed, press the **TARE** key to confirm. The full capacity will flash.
 7. Place the calibration weight onto the scale platform and press the **TARE** key .
 8. **CAEnd** will briefly be displayed and then return to normal weighing mode.
 9. Power off the scales, return the calibration switch to the OFF position and replace the calibration switch cover.

Note: If the display shows **Err-0** after power up, there is a problem with calibration. Repeat the calibration process.

10. Calibration

1. From normal weighing mode, press the **SET/0~9** key for 3 seconds to enter Setup mode.
2. Press and release the **SET/0~9** key to cycle through the parameter modes listed below.
3. To enter a parameter mode, press the **TARE** key.
4. Within a parameter mode, press the **SET/0~9** key to cycle through the options for that setting.
5. Press the **TARE** key to select the setting and to exit Setup mode.

PARAMETER	DEFAULT	SETTING
rAngE	oFF	Activate check weighing function: <ul style="list-style-type: none"> • ON = Activate the check weighing function and enter range limits • oFF = Deactivate the check weighing function
UnitS	Lb.Lb	Select the unit of measure: <ul style="list-style-type: none"> • H9 = kg • 9 = g • Lb.Lb = Pounds • Lb.oZ = Pounds/ounces • PcS = Counting mode (piece count will be displayed, weight will not) Note: Calibration must be done in kg or g
A- oFF	y	Auto off mode: <ul style="list-style-type: none"> • n = No auto power off • y = Auto off after 10 minutes of no operation or weight change
FILtX	FILt3	Display response speed: <ul style="list-style-type: none"> • FILt1 = One step to display • FILt2 = 3–4 steps to display • FILt3 = 6–8 steps to display • FILt4 = display is fast
ZErO	y	Set auto-zero range: <ul style="list-style-type: none"> • 0.5d • 1d • 1.5d • 2d • 2.5d • 3d • 4d • 4.5d • 5d Where “d” is the readability. See specifications.
bUZZEr	on	<ul style="list-style-type: none"> • on = Audible tone is on • oFF = Audible tone is off
D	See specifications	Change divisions (This setting should not be changed): <ul style="list-style-type: none"> • If this mode is entered accidentally, refer to the specification chart for the divisions for your scale. Press the SET/0~9 key to choose the default division setting and press the TARE key to confirm and exit.
d-dP	y	Dual display mode: <ul style="list-style-type: none"> • n = front display only • y = front and rear display

11. Display Symbol Meaning

0 ⁻⁻⁻⁻⁻ :	Power on zero-point is over (calibration zero-point) +20%FS) when scale is turned on, or the reading weight is over (power on zero-point) +5%FS when pressing ZERO button;
0 ₋₋₋₋₋ :	Power on zero-point is below (calibration zero-point) -20%FS) when scale is turned on, or the reading weight is + (power on zero-point) -5%FS when pressing ZERO button;
----- :	The current weight is over 100% FS +9d;
CAL-0 :	Zero point at calibration;
CAL-F :	Full capacity at calibration;
CAL.Er :	Calibration error;
EEP.Er :	EEPROM accessing error or data in EEPROM is an error or not in the normal range;
Lo.bAt :	The voltage of internal working is below 5.7V(+0.1V)

12. Troubleshooting

SYMPTOM	PROBABLE CAUSE	REMEDY
Will not power on	Power cord not plugged in or properly connected. Power outlet not supplying electricity. Battery is low. Other failure.	Check power cord connections. Make sure power cord is plugged into the power outlet. Check power source. Replace batteries. Or service required.
Unable to zero the display or will not zero	Load on scale exceeds allowable limits. Load on scale is not stable.	Remove load on scale. Wait for load to become stable. Service required.
Lo.bAt is shown	Battery is low	Replace new batteries.

13. Battery and Charging

There are three battery indicators on the display

- High = Battery voltage is greater than 6.3V
- Mid = Battery voltage is between 6V and 6.3V
- Mid = Battery voltage is lower than 6V

Note: If the battery voltage falls below 5.6V, the scale will automatically power off

Power is supplied by an internal rechargeable 6V Ni-MH battery (3800 mAh). When **bAtLo** is displayed, the battery must be recharged. Plug in the AC power cord to recharge the battery. Full charging time is approximately 10–12 hours. The scale may continue to be used on AC power during charging.

Battery life and recharge time will vary with use. Over time, the operating time per each full charge will degrade. If the operating time is no longer acceptable, the battery must be replaced. When storing the scale for extended periods, the battery must be charged every 90 days to avoid premature performance degradation.

14. Character Prompt Definitions

dc x.xx	Battery voltage is x.xx volts
-----	Scale capacity has been exceeded. Reduce the weight on the platform.
-AdC-	Analog/Digital converter overflow. Remove weight, zero the scale and try again.
bATLo	Battery is low and should be charged soon
c_End	Battery recharging is complete
Err-0	Scale has been overloaded. Remove weight, zero the scale and try again. If error code persists, loadcell has been damaged. Loadcells are not replaceable by the user. Contact the manufacturer at www.measuretek.net